



1217 E. 7th Street
Mishawaka, IN 46544
Phone: 1-800-334-4712
1-888-339-2539
Fax: 574-256-6743

T.I.P. Troubleshooting Information on Power Gear

Inner Rail Realignment

1. Remove cotter hairpin from idler drive shaft.
2. Push the idler drive shaft toward inner rail to disengage the gear from the gear rack.
3. Adjust the room by sliding the idler rail side of the room to the proper position (same distance from the frame as the drive rail side).
4. Push the idler drive shaft back into position engaging the gear and the gear rack.
5. Reinstall cotter hairpin in idler drive shaft.
6. Extend and retract room a couple of times and check for proper room flange sealing.
7. If room is not aligned properly, repeat steps 1 thru 6.

